
FlashPro v11.2 SP1B Release Notes

FlashPro software is packaged with Libero® Windows software and installed by default. If you install Libero SoC v11.2 for Windows you do not need to install FlashPro standalone.

FlashPro is available as a standalone installation as a convenience for programming-only installations.

Libero SoC v11.2 is a comprehensive software suite for designing with Microsemi's [SmartFusion2](#) and [SmartFusion](#) SoC FPGAs, and [IGLOO2](#), [IGLOO](#), [ProASIC3](#) and [Fusion](#) FPGA families.

Visit the Documents tab on your device page at www.microsemi.com to obtain silicon Datasheets, Silicon User's Guides, Tutorials and Application Notes.

[Development Kits and Starter Kits](#) are available from the Microsemi website.

Contents

[Supported Families](#)

- [Programming Support for SmartFusion2 and IGLOO2](#)

[What's New in FlashPro v11.2 SP1B](#)

[Introduced in FlashPro v11.2](#)

[Resolved Issues](#)

[Known Limitations, Issues and Workarounds](#)

[System Requirements](#)

[Download Libero SoC v11.2 SP1B](#)

Supported Families

IGLOO2, SmartFusion2, SmartFusion, Fusion, ProASIC3, ProASIC3E, ProASIC3L, IGLOO, IGLOOe, IGLOO+, ProASIC+, ProASIC

Programming Support for SmartFusion2 and IGLOO2

Programming file generation is enabled for these devices.

SmartFusion2

M2S150, M2S150S, M2S150T, M2S150TS (*New*)
M2S050, M2S050S, M2S050T, M2S050TS
M2S025, M2S025S, M2S025T, M2S025TS
M2S010, M2S010S, M2S010T, M2S010TS
M2S005, M2S005S
M2S050T_ES

IGLOO2

M2GL050, M2GL050S, M2GL050T, M2GL050TS
M2GL025, M2GL025S, M2GL025T, M2GL025TS
M2GL010, M2GL010S, M2GL010T, M2GL010TS
M2GL005, M2GL005S

What's New FlashPro v11.2 SP1B

Programming File Generation for SmartFusion2

M2S150, M2S150T, M2S150TS, M2S150S 1152 FC

Introduced in FlashPro v11.2

Programming Support

Programming file generation is enabled for IGLOO2 M2GL005 and M2GL005S

SmartFusion2 and IGLOO2 programming file generation on Linux is enabled.

Resolved Issues

Issues Fixed in v11.2 SP1B

SAR 52658 – Run Program action in the Libero will not program eNVM after adding a serialization client

SAR 51423 - Serialization file generation may take a long time

SAR 53285 – M2S150 and M2GL150 designs created using Libero SoC v11.2 or earlier releases may not work on silicon.

In previous releases the software allows you to select attributes that are not supported for the 150 devices. When a 150 design is opened using Libero SoC v11.2 SP2 it will be invalidated to a pre-Compile state.

Issues Fixed in v11.2

SAR 41668 – SW Update Check window opens in full screen; cannot see buttons.

SAR 51055 – Programming with a programming file that does not contain the fabric erases the design name and checksum.

SAR 47535 – Multiple dialog windows should not open for Programmer Settings, Update eNVM Memory Content and Device I/O States.

Known Limitations, Issues and Workarounds

Programming

SVF for SmartFusion2 and IGLOO2 will be available in a future release.

SAR 52921 - Exporting multiple M2S150 programming file types (STAPL, SPI, DAT) for design with security is not working.

Workaround: Export each programming file type individually.

SAR 52006 - Unable to generate the STAPL file with eNVM client of size 3 bytes or less

Workaround: Increase the size of the client to 4 bytes or more.

SAR 51767 - Error: The command 'load_programming_data' failed.

During programming file generation if the serialization content files cannot be found, then you will see the following error : "Error: The command 'load_programming_data' failed."

Workaround: Open **Update eNVM Memory Content** and specify a valid path for each serialization content file.

SAR 52264 - There is no error checking for hex values to ensure min is less than max

In the eNVM Memory Block dialog box when hex values are entered for min and max in auto increment data no error is reported if min is greater than max.

Error checking works correctly for decimal values.

SAR 45867 - STAPL player for SmartFusion2 or IGLOO2 will be available in a future release.**SAR 41069 - Add PDB loading from DDF for Libero environment**

You may get an exit 6 idcode failure when chain programming within Libero using a PDB file.

Workaround: Use a STAPL file or use the standalone FlashPro tool for chain programming

SAR 47452 - FlashPro verify and erase errors are reported as programming failures.

If you run programming ACTION VERIFY/ERASE and there is a failure, then the error code will indicate it is a programming failure even though you were running action VERIFY/ERASE.

SmartDebug

SAR 53356 - Live and Active probe are not supported for M2S150 devices in this release and will return incorrect values, if used.

SmartFusion2 devices will read invalid memory content if the MSS is held in the reset state or M3 is executing invalid microcode programmed into the Flash Memory.

Workaround: Program a valid design. Confirm that the MSS is not in the reset state.

SmartDebug SERDES will not work for M2S050PP and ES parts.

SmartDebug Tcl commands in the Libero flow will be supported in a future release.

System Requirements

Refer to [System Requirements](#) on the web for more information regarding operating systems support and minimum system requirements. 64-bit OS is required for designing SmartFusion2 and IGLOO2 150/100 devices.

Download FlashPro v11.2 SP1B

Installation requires admin privileges

[Windows](#)



Microsemi Corporate Headquarters
One Enterprise, Aliso Viejo CA 92656 USA
Within the USA: +1 (949) 380-6100
Sales: +1 (949) 380-6136
Fax: +1 (949) 215-4996

Microsemi Corporation (NASDAQ: MSCC) offers a comprehensive portfolio of semiconductor solutions for: aerospace, defense and security; enterprise and communications; and industrial and alternative energy markets. Products include high-performance, high-reliability analog and RF devices, mixed signal and RF integrated circuits, customizable SoCs, FPGAs, and complete subsystems. Microsemi is headquartered in Aliso Viejo, Calif. Learn more at www.microsemi.com.

© 2013 Microsemi Corporation. All rights reserved. Microsemi and the Microsemi logo are trademarks of Microsemi Corporation. All other trademarks and service marks are the property of their respective owners.